

Subject: Use of spark plugs

Affected engine models: All engine models:

L 1700
L 2000
L 2400

Background information: Compilation of current spark plugs

Priority: On replacement of spark plugs

Compliance: Use of spark plugs according to the following table:

Engine Type	Spark Plug	Ignition Harness	Remarks
L 1700 E0, EA, EB, EC, ED	LIMBACH LB-K-2 170.123.104	170.123.022	*)
	LIMBACH LB-K-3 170.123.105	170.123.023	**)
L 2000 E0, EA, EB	LIMBACH LB-K-2 170.123.104	170.123.022	*)
L 2000 EC (American Blimp/ Lightship Group)	LIMBACH LB-K-3 170.123.105	170.123.023	**)
	LIMBACH LB-K-2 170.123.104	209.123.022	*)
L 2000 DA	LIMBACH LB-K-3 170.123.105	209.123.023	**)
	LIMBACH LB-L-2 205.123.103	205.123.012 LI 205.123.022 RE	*)
L 2400 EB, EE	LIMBACH LB-L-3 205.123.102	205.123.013 LI 205.123.023 RE	**)
	LIMBACH LB-K-2 170.123.104	170.123.022	*), ***)
L 2400 EB1AD	LIMBACH LB-K-2 170.123.104	246.123.022	*), ****)
	LIMBACH LB-K-3 170.123.105	246.123.023	**), ****)
L 2400 DF, DT, EF, ET, DX, DS	NGK DCPR7E 250.123.101	-----	*****)

- *) Unshielded spark plug
- ***) Shielded spark plug
- ****) Not for 24EB1AD (Stemme S 10)
- *****) For Stemme S 10
- *****) Ignition cable depending on version, see spare parts catalog

For engines of the L 1700, L 2000 and L 2400 EB, EE series, a choice can be made between shielded and unshielded spark plugs when using appropriate ignition harnesses.

Note: Please note that only the current spark plugs and ignition harnesses are listed in the table on page 1. For the use of other spark plugs and ignition harnesses, see the operating and maintenance manual for the corresponding engine models.

This document has been translated to the best of our knowledge. In case of doubt however only the German original shall be considered authoritative.

Source: Limbach Flugmotoren GmbH, Kotthausener Str.5, 53639 Königswinter, Germany
Tel: 02244-92010, Fax: 02244-920130, www.limflug.de

Approval: The technical content of this document is approved under the Authority of EASA ref. approval number 10080637 and have been produced in accordance with alternative procedure to DOA nr. EASA.AP509.