

## **Maintenance Instruction**


26.2

**Subject:** Cylinders and Cylinderheads on repaired or exchange engines

**Affected engines:** All engines of the following types:

L 1700 L 2000 L 2400

As from now, engines witch are fitted with reworked cylinder heads and/or cylinders, are fitted with shims (C) under the cylinders. Reworked cylinders and cylinder heads are marked with up to three asterixes (\*). The cylinder heads are marked near the exhaust flange in the vicinity of the part number (A), the cylinders are marked at the base near the cylinder number (B).

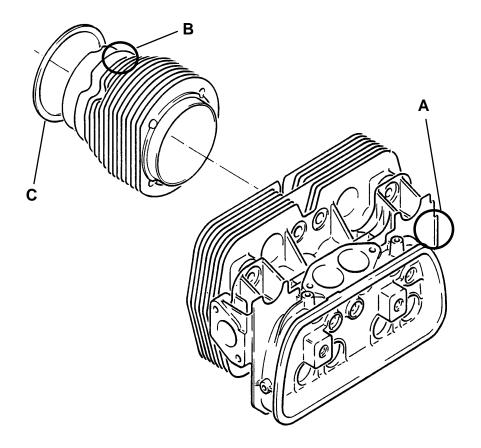

The two adjoining cylinders must have the same rework stage (number of asterixes). The shims are coated with sealant (REINZOSIL SI 300) on both sides.

Note: All surfaces that have contact with the sealant, must be free of grease or oil. For the required thickness of the shims refer to the following tables.

Bearb.: Papadopulos	Replaces edition from: 12.07.07	Page: 1 of 2 Pages
Gepr. + Freig.:	Edition: 21.05.19	File: MI26-2.doc





## **Maintenance Instruction**

## L 2000 and L 2400 series:

Mark	kings	
cylinder head	cylinder	Shim thickness (mm)
-	*	0,50
-	**	0,75
-	***	1,00
*	*	1,00
*	**	1,25
*	***	1,50
**	*	1,25
**	**	1,50
**	***	1,75
***	*	1,50
***	**	1,75
***	***	2,00
*	-	0,50
**	-	0,75
***	-	1,00

## L 1700 series:

always recieves new cylinders for repair and overhaul. Therefore only reworked cylinder heads are considered for this series.

Mark	kings	
cylinder head	cylinder	Shim thickness (mm)
*	-	0,50
**	-	0,50
***	-	0,75

For information regarding the assembly please refer further to the applicable maintenance instructions or the repair manual

Notice:

This document has been translated to the best of our knowledge. In case of doubt, however, only the German original shall be considered as authoritative.

Bearb.: Papadopulos	Replaces edition from: 12.07.07	Page: 2 of 2 Pages
Gepr. + Freig.:	Edition: 21.05.19	File: MI26-2.doc